 


10001031

ATTENTION:
GENERAL MANAGER ☐ PARTS MANAGER ☐
CLAIMS PERSONNEL ☐ SERVICE MANAGER ☐
IMPORTANT - All Service Personnel Should Read and Initial



SUBARU



SERVICE BULLETIN

APPLICABILITY: All 1999~2002MY 2.5L and
2002MY 2.0L WRX Vehicles

NUMBER: 03-51-02

DATE: 01/15/03

SUBJECT: Cold Clutch Judder

INTRODUCTION

In the event you encounter a customer concern of cold clutch judder that goes away after the first few applications, replacement of the clutch parts listed below will be necessary to repair the vehicle. Prior to replacing these parts, you should confirm the engine and transmission mounting is not broken, loose, or mis-aligned.

	2.5L N/A	2.5L Turbo
Flywheel (*2)	12342AA061 (*1)	12342AA071
Cover	30210AA590	30210AA570
Disc	30100AA850	30100AA840
Bolts (6pc) needed, cover to flywheel	800508310	800508310
Bolts (8pc) needed for Legacy only	800610740	N/A

(*1) When using this flywheel on Legacy models, you must replace the 8 flywheel to crankshaft bolts.

(*2) If the OE flywheel has more then 30,000 miles on it, and is in good condition, it can be reused. After 30,000 miles of driving, the surface finish is equivalent to the replacement flywheel.

These parts were introduced into vehicle production from the start of 2003 model year.



**CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD
RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.**

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

